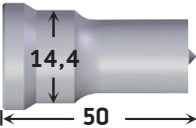
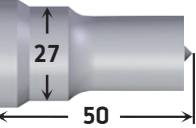
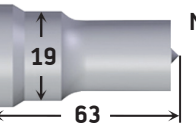
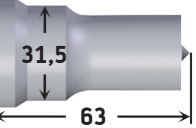
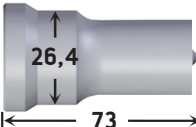
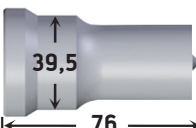
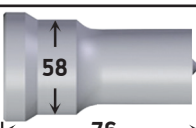
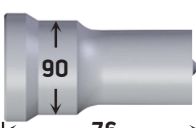


Pons

	Rond	Ovaal	Vierkant
 N° 1 14,4 50	Ø 3 - 14	5x10 5x14 5,5x10 5,5x14 6x12 6,5x12 7x14 - 7,5x14	4 - 10
 N° 4 27 50 N° 4B *	Ø 8 - 27 Ø 27,5 - 30	5,5x19 5,5x25 6,5x18 6,5x26 7,5x21 7,5x26 8x16 9x18 9x26 10x20 10x26 10x30 11x22 11x26 12x24 13x26 14x26 14x28 15x30 16x26 18x26	11 - 19 20 - 21 *
 N° 2 19 63	Ø 3 - 19	5x10 5x14 5,5x10 5,5x14 6x12 6,5x12 6,5x18 7x14 7,5x14 8x16 9x14 9x18	4 - 13
 N° 5 31,5 63	Ø 17,5 - 31,5	5,5x25 6,5x26 6,5x30 7,5x21 7,5x26 7,5x30 9x26 9x30 10x20 10x26 10x30 11x22 11x26 11x30 12x24 12x30 13x26 14x26 14x28 15x30 16x26 16x31 18x26 18x31 20x31 22x31	14 - 22

Oversize ponsen, snelwissel ponshouder Ø 30,3 benodigd.

 N° 3 26,4 73	Ø 5 - 26	5x10 5x14 5,5x14 5,5x19 5,5x25 6,5x12 6,5x18 6,5x26 7,5x14 7,5x21 7,5x26 8x16 9x18 9x26 10x20 11x22 11x26 12x24 13x26 14x26 16x26 18x26	8 - 18
 N° 6 39,5 76	Ø 27 - 39,5	6,5x30 7,5x30 9x30 9x35 10x30 11x30 12x30 12x35 13x30 13x35 14x28 14x35 16x31 18x31 18x36 20x31 22x31	19 - 28
 N° 7 58 76	Ø 40 - 58	11x40 12x40 13x40 14x50 16x55 18x55 20x40 20x55 22x44 22x55	30 - 35 - 40
 N° 11 90 76	Ø 59 - 90	Alle afmetingen	41 - 63

Peddinghaus gereedschap per machine

Pons / Stempel	Matrijs	Machines
N° 1, 4, 4B	N° 2, 13	Peddicat 360, Peddiworker 400, 500, 600 en 800. Peddimaster 450M, 28/40, 40/60, 60/80, 60/100 en 80/110. Hydraulic 28, 40, 60N, 300, 400, 500, 600, 210 Super/Standaard 11 en 13. Forax 15, 25, 45, 65, 150, 250, 450, Stanzfix, 225 B/11, 13, 45, 60 en 225H/11, 13.
N° 2, 5	N° 3, 14	Peddicat 361 en 380 - Peddiworker 501, 502, 801, 802 en 1000G. Peddimaster 100/160, 110/170, 800/1100 en 1100/1700. Peddimax 600, 601, 602, 800, 801, 1002 en 110/140. Hydraulic 100, 280, 301, 501, 502, 800, 1000, 1001, 210 Super 16, 20 en 210 Standaard 16. Forax 80, 100, 1000, 225 B/16, 20, 80, 100 en 225H/15, 20.
N° 3, 6, 7, 11	N° 4, 6, 20	Zie de oversize pons informatie

